


Craig Lee -Equal Power Panner board


Fixes needed on REV 4.0 board date #121120

Jumper PINS 2 &3
on both SIPs

CUT these traces

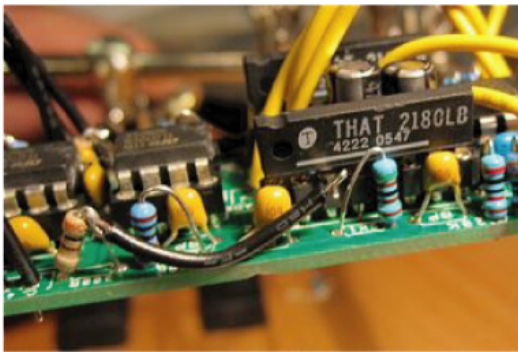

Jumper wire from 300R to
THAT2180 pin

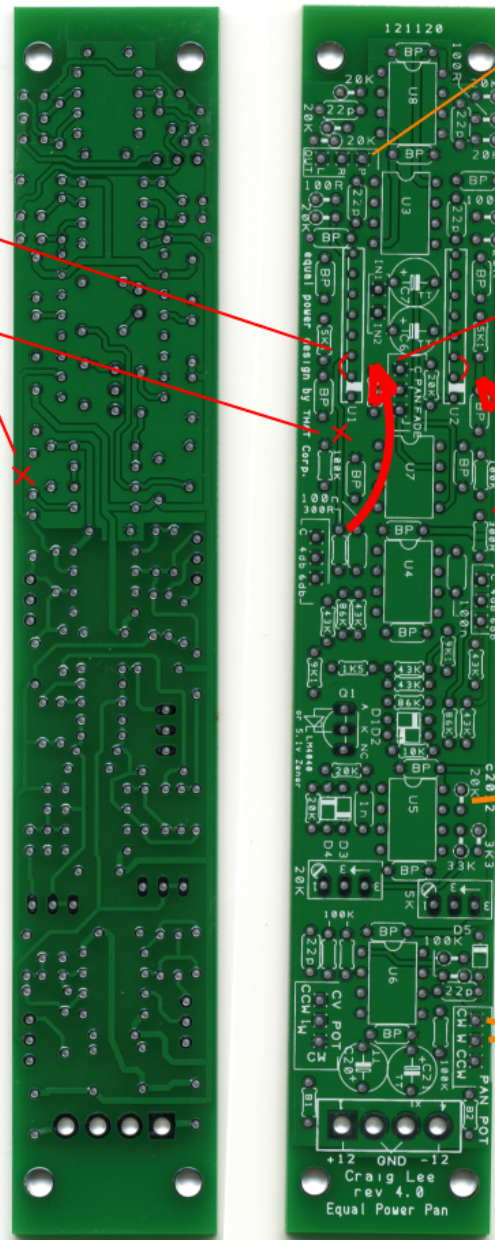

"P" is the
crossfade out

Jumper from 300R
to PIN 2 of the 2180

Jumper from 300R
to PIN 3 of the 2180

(the 2180 pin soldered
should not be attached
to the board or socket)

22K
(not 20K)

These are reversed
(connect wiper to "CW")

INPUT 2 is the main input (the one connected when using as a panner)

Install all resistors and diodes standing up.

PLEASE REMEMBER - the orientation of the THAT2180s is REVERSED from the op amps. PIN1 down where the op amps are PIN1 up (this allows a short trace from the output to the op amp)